


KRD/KSD		
mm ²	KRD/KSD	No. of crimps
10	B8	1
16	B8	1
25	B9	1
35	B11	1
50	B12	1
70	B14	1
95	B16	1
120	B19	1
150	B22	1
185	B25	1
240	B27	1
300	B30	1
400	B2532*	1
500	B2540*	2
630	B2545*	3
800	B2553*	3

* Use without die holders.

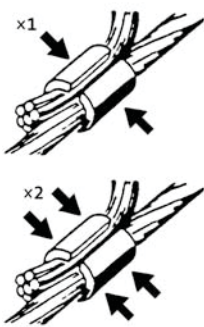

Crimp sequence.

DIN46235		
mm ²	DIN46235 dies	No. of crimps
10	B6DIN	1
16	B8DIN	1
25	B10DIN	1
35	B12DIN	1
50	B14DIN	1
70	B16DIN	1
95	B18DIN	1
120	B20DIN	1
150	B22DIN	1
185	B25DIN	2
240	B28DIN	2
300	B32DIN	3



Die holder V2508 + BC-dies + die holder V2506.

For oval crimping of Cu branch connectors (C sleeves). If not otherwise indicated, use inner die holder V2506 and outer die holder V2508.

Main conductor mm ²	Branch mm ²	Dies	No. of crimps
10-6	10-6	BC4*	1
16-10	16-6	BC5	1
25-16	25-16	BC6	1
50-16	50-16	BC8-9	1
70-50	70-25	BC11	1
95-70	95-25	BC13	1
120-95	120-25	BC15	1
150-120	150-35	B25C16**	1
185-150	185-35	B25C18**	2
300-240	300-35	B25C21**	2

* Die nest must be marked C4A to connect 6 mm² main to 6 mm² branch. ** Use without die holders.